

Date Inspected	Section Number	Map Page	Location	Start ID	Stop ID	Original Diameter (in)	Actual Diameter (in)	Pipe Material	Depth (ft)	Original Length (ft)	Televised Length (ft)	Diff. Length (ft)	Structural Rating PACP	Maintenance Rating PACP	Cleaning Effort	Recommendation	Repair Method	Cost Estimate*	Priority
2/5/2026	99-A/99-B	B1	Vista De Montanas	99-A	99-B	15	15x20	CMP	1.5	54	0	-54	UNK	UNK	Heavy	Unable to inspect due to pipe being full of sand and rocks. Need to clean and reinspect.	Clean & Reinspect	\$ 11,073	TBD
2/6/2026	87-A/87-B	A1	Calle De Lobo	87-A	87-B	30	30	CMP	1	78	0	-78	UNK	UNK	Heavy	Unable to inspect due to pipe being full of debris. Need to clean and reinspect.	Clean & Reinspect	\$ 11,073	TBD
2/5/2026	89-A/89-B	A1	Calle De Lobo	89-A	89-B	21	24	CMP	1	37	0	-37	UNK	UNK	Heavy	Unable to inspect due to pipe being full of debris. Need to clean and reinspect.	Clean & Reinspect	\$ 8,323	TBD
2/5/2026	93-A/93-B	A1	Calle De Campanero	93-A	93-B	24	UNK	CMP	1	50	0	-50	UNK	UNK	Heavy	Unable to inspect due to pipe being full of debris. Need to clean and reinspect.	Clean & Reinspect	\$ 8,323	TBD
2/3/2026	44-A/44-B	B2	Calle De Suenos	44-A	44-B	18	24	CMP	2	63	0	-63	UNK	UNK	Moderate	Unable to inspect due to access. Photos show rusted invert, large boulders and defect in crown of pipe near upstream end. No access to downstream end on other side of fence (private property). Need to arrange access and attempt reinspection. Possible clearing and grubbing required.	Clean & Reinspect	\$ 11,073	TBD
2/2/2026	8-A/8-B	B2	Paseo Chaparro	8-A	8-B	18	18	CMP	2	53	59.4	6.4	5534	2500	Moderate	Debris and rocks throughout. Voids and holes in pipe @ 6, 13, and 35'. Intruding rock @ 30'. Downstream end is crushed and access is blocked by bushes and tree.	Dig & Replace	\$ 47,400	High
2/2/2026	15-A/15B	B2	Avenida La Cresta	15-B	15-A	24	24	CMP	1	85	85.8	0.8	5841	4100	Moderate	Voids and holes throughout pipe. Cut and trim sharp edges @ 13-20, and 52'. Intruding bulges in crown and invert @ 16, 20, and 31'. Void @ 52'. Downstream end is crushed.	UV-CIPP	\$ 44,631	High
2/3/2026	26-A/26-B	B2	Paseo de Flores	26-A	26-B	42	42	CMP	5	73	44.9	-28.1	533B	3800	Heavy	Camera blocked by debris and standing water. Heavy debris @ 0-45' unable to see bottom condition of pipe. Invert appears to be missing @ 0 8'. Standing water @ 45'. Both ends of pipe need to be cleared and regraded.	UV-CIPP & Regrade	\$ 55,933	High
2/3/2026	53-A/53-B	A2	Avenida De Arboles	53-B	53-A	24	24	CMP	1	71	60.4	-10.6	5235	3100	Moderate	Invert rusted throughout. Intruding bulge and sharp pieces in crown @ 50'. Upstream end is deformed.	UV-CIPP	\$ 39,185	High
2/3/2026	53-C/53-D	A2	Avenida De Arboles	53-D	53-C	24	24	CMP	1	71	57.8	-13.2	5138	3121	Moderate	Camera blocked by debris and standing water @ 12'. Void and CMP broken @11'. Reverse pull reached overlap point @ 45'. Intruding bulge in crown @ 10'. Upstream end is bent.	UV-CIPP	\$ 38,766	High
2/3/2026	38-A/38-B	B1	Calle De Suenos	38-B	38-A	12	12	CMP	1.5	45	48.6	3.6	5141	0000	Light	Collapse @ 15'. Intruding bulge in crown @ 24 and 45'. Downstream end is deformed.	Dig & Replace	\$ 45,768	High
2/2/2026	11-A/11-B	B2	Paseo Chaparro	11-A	11-B	24	18	CMP	1	49	43.5	-5.5	5141	2300	Light	Pipe is 18" not 24". Cut and trim sharp edges @ 9' and bulging pipe @ 28'.	UV-CIPP	\$ 29,229	High
2/4/2026	40-A/40-B	B1	Calle De Suenos	40-A	40-B	18	30	CMP	1.5	83	70.7	-12.3	3100	5132	Heavy	Camera blocked by debris. Intruding bulge in invert and side @ 30'. Heavy cleaning @ 50'. Upstream end is deformed. If pipe can be cleaned w/ jet-vac truck, lining is possible.	Clean & Reinspect (possible UV-CIPP)	\$ 41,719	Medium
2/3/2026	32-A/32B	B1	Avenida Castilla	32-B	32-A	24	24	CMP	1	36	48.6	12.6	0000	3722	Heavy	Heavy debris @ 0-49' unable to see bottom condition of pipe. Both pipe end are deformed. If pipe can be cleaned w/ jet-vac truck, lining is possible.	Clean & Reinspect (possible UV-CIPP)	\$ 40,344	Medium
2/5/2026	94-A/94-B	A1	Calle De Companero	94-A	94-B	15	15x20	CMP	1	38	19.8	-18.2	3600	2200	Heavy	Camera blocked by debris. Invert has rust. Unable to complete reverse pull from downstream; buried. Need to clean and reinspect. If pipe can be cleaned w/ jet-vac truck, lining is possible.	Clean & Reinspect (possible UV-CIPP)	\$ 30,505	Medium
2/3/2026	29-A/29-B	B2	Avenida Castilla	29-A	29-B	12	12	CMP	1	50	56	6	5200	3323	Heavy	Heavy debris @ 0-50' unable to see bottom condition of pipe. Invert appears to be rusted throughout. If pipe can be cleaned w/ jet-vac truck, lining is possible.	Clean & Reinspect (possible UV-CIPP)	\$ 22,007	Medium
2/2/2026	6-A/6-B	B2	Paseo Chaparro	6-B	6-A	12	12 (DS) x 9.75 (US)	CMP to PVC	1	58	45.4	-12.6	4132	5431	Heavy	Camera blocked by diameter/material change. Downstream end is crushed.	Dig & Replace	\$ 46,075	Medium
2/2/2026	17-A/17-B	B2	Avenida La Cresta	17-A	17-B	36	36	CMP	3	73	82	9	3800	4A00	Heavy	Intruding bulge in side @ 5'. Heavy debris @ 10-82' unable to see bottom condition of pipe. Upstream end is deformed.	UV-CIPP	\$ 44,317	Medium
2/5/2026	81-A/81-B	A2	Calle De Lobo	81-A	81-B	48	48	CMP	10	38	58.7	20.7	5131	2500	Moderate	Invert has rust throughout. Missing invert upstream end.	UV-CIPP	\$ 58,842	Medium
2/2/2026	7-A/7-B	B2	Paseo Chaparro	7-A	7-B	18	18	CMP	2	58	55.7	-2.3	4137	2311	Moderate	Camera blocked by debris and rocks. Dropped section of pipe @ 40'. Intruding crown damage @ 50'.	UV-CIPP	\$ 30,818	Medium
2/4/2026	100-A/100-B	B1	Via De Montanas	100-A	100-B	18	18	CMP	1.5	45	44.2	-0.8	5200	2200	Moderate	Invert has minor rust throughout. Downstream end is crushed and needs clearing.	UV-CIPP	\$ 27,618	Low
2/3/2026	20-A/20-B	A2	Avenida La Cresta	20-A	20-B	24	24	CMP	1.5	73	48.1	-24.9	5100	0000	Light	Invert rusted throughout. Downstream end is deformed.	UV-CIPP	\$ 32,970	Low
2/4/2026	47-A/47-B	B1	Via Caballos	47-B	47-A	18	18	CMP	1	66	70.4	4.4	5332	2411	Light	Intruding bulge in crown @ 12, 36' and side @ 32, 45'. Angle point @ 48'. Sharp edges and holes @ 52'. Void @ 69'.	UV-CIPP	\$ 28,936	Low
2/5/2026	97-A/97-B	B1	Vista Del Bosque	97-A	97-B	?	12	CMP	2.5	78	60.5	-17.5	513A	2200	Moderate	Invert has rust throughout. Downstream end is deformed.	UV-CIPP	\$ 28,646	Low

Date Inspected	Section Number	Map Page	Location	Start ID	Stop ID	Original Diameter (in)	Actual Diameter (in)	Pipe Material	Depth (ft)	Original Length (ft)	Televised Length (ft)	Diff. Length (ft)	Structural Rating PACP	Maintenance Rating PACP	Cleaning Effort	Recommendation	Repair Method	Cost Estimate*	Priority
2/5/2026	85-A/85-B	A1	Paseo Montana	85-A	85-B	30	30	CMP	3	62	80.9	18.9	0000	3721	Heavy	Heavy debris and rocks @ 0-45'. Intruding bulge in crown and angle point right @ 35'. Downstream end is deformed. Pipe will need to be lined eventually, but an additional access point would need to be installed at the bend to do so.	Confined Space Entry Repairs	\$ 9,502	Low
2/5/2026	92-A/92-B	A1	Calle De Companero	92-A	92-B	36	36	CMP	1	60	65.3	5.3	0000	3A00	Heavy	Invert has minor rust throughout. Separated joint @ 30'. Upstream end is deformed. Downstream access is on other side of fence.	UV-CIPP	\$ 67,242	Low
2/3/2026	33-A/33-B	B1	Avenida Castilla	33-B	33-A	24	24	CMP	1	42	43.6	1.6	0000	2900	Moderate	Moderate debris and rocks @ 27'. Invert rusted throughout.	UV-CIPP	\$ 28,257	Low
2/3/2026	70-A/70-B	A2	Via Mojorca	70-B	70-A	24	24	CMP	8	88	94	6	0000	2100	Light	Invert has minor rust. Need to remove and replace cage on vertical tin whistle pipe at upstream end.	UV-CIPP	\$ 37,412	Low
2/3/2026	80-A/80-B	A2	Via Huerta	80-B	80-A	15	18	CMP	1	64	39.8	-24.2	0000	0000	Light	Invert rusted throughout. Intruding bulge in side @ 7'. Concrete buildup at upstream and downstream ends needs to be removed. Downstream end is deformed.	UV-CIPP	\$ 30,824	Low
2/3/2026	34-A/34-B	B1	Avenida Castilla	34-B	34-A	18	21	CMP	1	36	37.1	1.1	0000	0000	Light	Light debris and rocks throughout. Invert rusted and holes throughout. Intruding bulge in invert @ 35'. Remove concrete at upstream end.	UV-CIPP	\$ 26,298	Low
2/4/2026	98-A/98-B	B1	Via Del Bosque	98-B	98-A	?	18	CMP	1	69	59.5	-9.5	0000	0000	Light	Invert has minor rust throughout. Upstream end needs clearing.	UV-CIPP	\$ 33,232	Low
2/4/2026	35-A/35-B	B1	Avenida Castilla	35-A	35-B	24	24	CMP	2.5	51	46.7	-4.3	0000	0000	Light	Invert has minor rust throughout. Rocks will need to be moved at both pipe ends.	UV-CIPP	\$ 25,252	Low

*Cost estimates are based on CCTV inspection crew data and measurements; site visits will be required to finalize any pricing.