





2008 Hawker 750 | N770GS

Serial Number HB-3

Airframe Total Time (as of 11/30/19)

1,155.7 Hours 1,068 Landings



Engine Total Time (as of 11/30/19)

#1 1,155.7 Hours

1,068 Cycles

#2 1,155.7 Hours

1,068 Cycles

APU Total Time (as of 11/30/19)

1,074 Hours

Engines

Honeywell TFE-5BR-1H

Engines on MSP Gold

APU on MSP Gold

Contact Brad Stancil +1 (317) 815-9403 Info@HolsteinAviation.com

Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Aircraft Highlights

- One Corporate U.S. Owner / One Crew Since New
- Engines & APU on MSP Gold
- Avionics on CASP
- Collins Modernization Package
- WAAS / LPV / ADS-B Out
- Synthetic Vision
- DBU-5000 Data Loaders
- Dual Collins HF-9000 with SELCAL
- Honeywell Solid State Flight Data Recorder
- Paperless Cockpit / Electronic Charts
- New Carpet & Sidewalls June 2019
- No Known Damage History (Note: Tail cap replaced with new part due to lightning strike; logbook entry available upon request)

Inspection & Maintenance History

400 Hour Walk Around complied with @ 802.9 hours; next due @ 1202.9 hours

B1-B10 Inspection complied with @ 802.9 hours; next due @ 1602.9 hours

C1-C10 Inspection due @ 1600.0 hours

D1-D10 Inspection due @ 3200.0 hours

E1-E10 Inspection complied with July 2019; next due June 2020

F1-F10 Inspection complied with June 2018; next due May 2020

G 48 Month Inspection complied with June 2016; next due July 2020

48 Month Structurals complied with June 2016; next due July 2020

96 Month Structurals complied with June 2016; next due May 2024

15/18 Year 216 Month Inspection due May 2023

MLG Gear OVH due at 5000 landings; March 2020

LH & RH Engine MPI due @ 2100 engine hours

LH & RH Engine CZI due @ 4200 engine hours

Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Avionics

Collins Pro Line 21 Avionics

Dual Collins VHF-4000 Comms

Collins NAV-4000 VOR/LOC/GLS/ADF/Marker Beacon Receiver

Collins NAV-4500 VOR/LOC/GLS/Marker Beacon Receiver

Collins IFIS with single FSU-5010 File Server Unit

Collins GPS-4000A

Dual TDR-94D Enhanced Surveillance with Flight ID Diversity Transponders

Dual Collins DME-4000

Dual Collins AHC-3000 AHRS

Dual Collins ADC-3000 Air Data Computers

Collins FMS-6000 Flight Management Systems

Dual Collins CDU-6200 Control Display Units for FMS and Radio Control

Collins MDC-3110 Maintenance Diagnostics Computer

Dual Collins FGC-3000 Flight Guidance Computers

Universal CVR-120 with 2 hour recording capability

Collins TWR-850 Turbulence Weather Radar

Collins ALT-4000 Radio Altimeter

Collins TCAS-4000 TCAS II

Artex C406-N ELT

Honeywell Mark V EGPWS

Features and Options

XM Graphic Weather

Paperless Cockpit

Electronic Charts

Dual Collins HF-9000 HF Comm System with SELCAL

2nd Collins FMS-6000 FMS/GPS-4000A

2nd Graphical AFD-3010E Display and Cursor Control Panel CCP

Honeywell Solid State FDR (SSFDR)

2nd Collins ADF

High Intensity Radiated Field (HIRF) Kit

AirCell ST3100 Iridium Phone

Cabin Audio/Video Entertainment System

Airshow 410 System w/Flight Deck Controller

2nd 15" LCD Monitor

Power Outlet Package - 110

Enhanced Refreshment Center Package

Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Features and Options - continued

Long Range Oxygen (2 x 750 ltr bottles)

Precise Flight Pulselite system with TCAS Interface

Cabin/Vestibule Hinged Door

Wood Veneer Sideledge in lieu of Leather

Additional Stowage Drawers under each Club Seat (4)

Drop Down Inboard Armrests (all individual chairs)

Belted Lavatory Seat

Protection Package – Additional Center Aisle Carpet, Set of Throw Rugs, Center Aisle Maintenance Runner, and Threshold Carpet

Galley in accordance with design DWG #HB02-87

Galley mods – replace one Mapco with a hot cup. Remove can and other storage space to the right of the Mapco, this area will be used for storage and will have a shelf. Metalwork will be a "brushed" finish instead of "polished".

Two shipsets of five (5) cabin chairs and one (1) divan armrest cover

Portable oxygen bottle behind forward right hand bulkhead

Carpet edges finished with binding

Tie down straps for Medical Med Air kits (kit to be provided by customer). Medical Med Air Kit to be located at the aft side of the forward bulkhead of the aft right hand closet.

Forward RH baggage with net/webbing fixed on forward side and curtain fixed on forward side Galley Mod: top Kydex insert adjacent to microwave to divide for coffee stirs and creamer/sugar packets


Three (3) extra seat belt extensions

Pyramid cabinet with can storage

Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Exterior

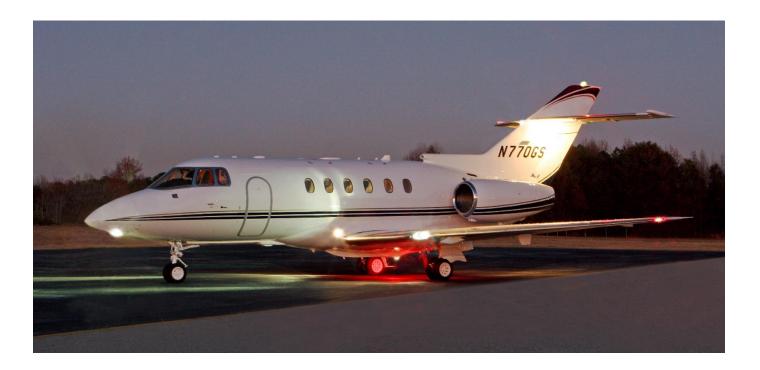



Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Interior - New carpet and sidewalls - June 2019





Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Interior - continued





Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.



Cockpit



Specifications subject to verification upon inspection. Aircraft subject to prior sale without notice.

- END-